


FLYNT
PUMP COMPANY

**MKII SERIES
PUMPS LESS
VOLUTE**



**REPAIR PARTS
FOR "1600" SERIES**

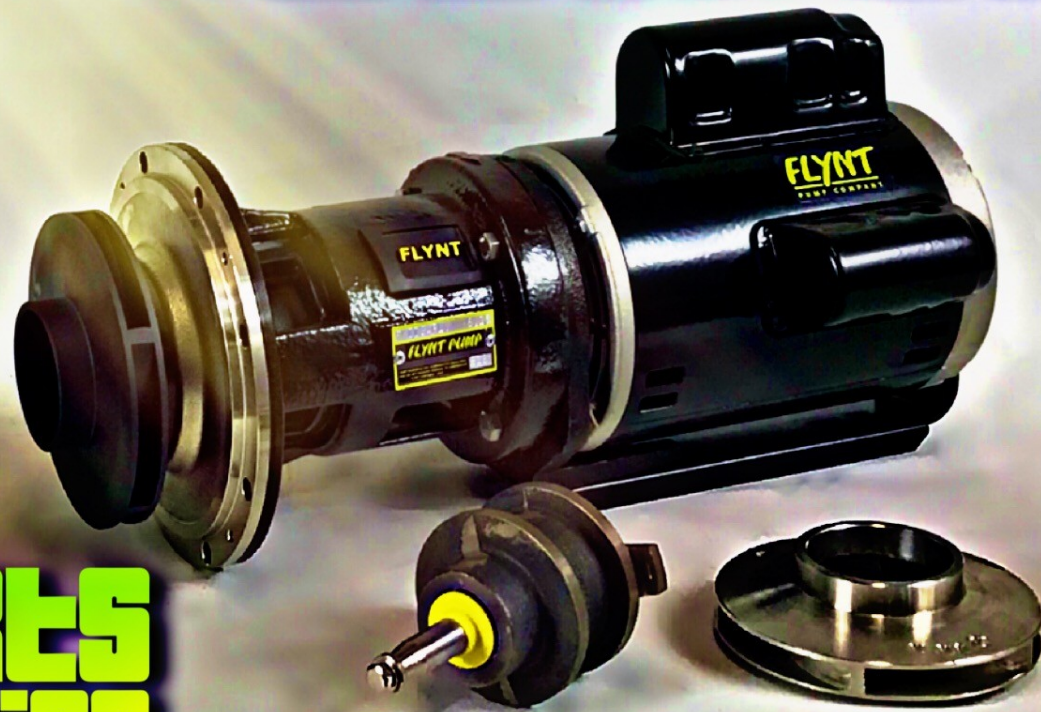

MKII SERIES QUICK REFERENCE CROSSOVER SHEET

1600 SERIES STANDARD BUILD REPLACEMENT PUMPS LESS VOLUTE

FLYNT	TACO	HP
MKII00PLV	1600	1/2
MKII10PLV	1610	1/2
MKII12PLV	1612	1/2
MKII14PLV	1614	3/4
MKII30PLV	1630	1/2
MKII32PLV	1632	3/4
MKII34PLV	1634	1
MKII36PLV	1636	1 1/2
MKII38PLV	1638	2

1600 SERIES CUSTOM BUILD REPLACEMENT PUMPS LESS VOLUTE

FLYNT	TACO	HP
MKII1150PLV	1611	1/2
MKII1550PLV	1615	1/2
MKII1575PLV	1615	3/4
MKII1510PLV	1615	1
MKII3550PLV	1635	1/2
MKII3575PLV	1635	3/4
MKII3510PLV	1635	1
MKII3515PLV	1635	1 1/2
MKII4115PLV	1641	1 1/2
MKII4120PLV	1641	2

- STANDARD CONSTRUCTION INCLUDES COMPOSITE IMPELLER MODELS "00"- "35". STAINLESS STEEL STANDARD MODELS "36"- "41". STAINLESS STEEL OPTIONAL ON MODELS "30" - "35" UP TO 5.65"
- ALL MODELS ARE SINGLE PHASE, DUAL VOLTAGE, ODP, TEFC AND 3 PHASE AVAILABLE

1900 / 1600 SERIES REPLACEMENT PUMPS LESS VOLUTE

FLYNT	TACO	HP	IMP DIA
MKIII1125PLV	1911 / 1611 / 1600	1/4	SPECIFY
MKIII1133PLV	1911 / 1611	1/3	SPECIFY
MKIII10PLV	1610	1/3	4.50"
MKIII1150PLV	1911 / 1611	1/2	SPECIFY
MKIII1175PLV	1911 / 1611	3/4	SPECIFY
MKIII1110PLV	1911 / 1611	1	SPECIFY
MKIII1533PLV	1915 / 1615	1/3	SPECIFY
MKIII1550PLV	1915 / 1615	1/2	SPECIFY
MKIII12PLV	1612	1/2	5.75"
MKIII1575PLV	1915 / 1615	3/4	SPECIFY
MKIII14PLV	1614	3/4	6.35"
MKIII1510PLV	1915 / 1615	1	SPECIFY
MKIII1515PLV	1915 / 1615	1 1/2	SPECIFY
MKIII3550PLV	1935 / 1635	1/2	SPECIFY
MKIII30PLV	1630	1/2	4.90"
MKIII3575PLV	1935 / 1635	3/4	SPECIFY
MKIII32PLV	1632	3/4	5.65"
MKIII3510PLV	1935 / 1635	1	SPECIFY
MKIII32PLV	1634	1	6.15"
MKIII3515PLV	1935 / 1635	1 1/2	SPECIFY

Recommended Optional Replacements for "1600" Series

- ALL MARK III PUMP ARE SINGLE PHASE, DUAL VOLTAGE, TEFC STANDARD
- STANDARD CONSTRUCTION INCLUDES COMPOSITE IMPELLER; STAINLESS STEEL OPTIONAL ON MODEL "35" UP TO 5.65"
- ALL MARK III PUMPS AVAILABLE IN 3 PHASE
- ALL PUMPS NOT NOTED WILL BE SHIPPED WITH FULL DIAMETER IMPELLER UNLESS SPECIFIED



P U M P C O M P A N Y

MKII to "1600" REPAIR PARTS CROSSOVER SHEET

FLYNT	TACO
IMPELLER WASHER	
151IMPW	1600-151RP
IMPELLER BOLT	
215IMPBLT	1600-215RP
WATER SEAL KIT	
MKIISLK	1600-868CRP
MKIISLKSC	1600-868SRP
SHAFT SLEEVE (!)	
205SSLV	1600-205RP
CARTRIDGE ASSEMBLY	
MKIIBA-M	1600-160RP-1

FLYNT	TACO
BODY GASKETS	
MKIIBG-A	1600-024RP
MKIIBG-BC	133-014RP
MKIIBG-D	1618-006RP
FLANGE KITS	
FP-200K	1600-032RP, 1600-032SRP
FP-250K	1600-033RP, 1600-033SRP
FLANGE GASKETS	
MKIIFGKT2	1600-009RP
MKIIOGKT2	1600-169RP

FLYNT	TACO
IMPELLERS - COMPOSITE	
MKII2500N	1610-179SRP 4.25"
MKII2510N	1610-019SRP 4.50"
MKII25102N	1610-020SRP 4.75"
MKII2511N(*) SPECIFY TRIM	1611-001SRP 4"-4.75"
MKII2512N	1612-019SRP 5.75"
MKII2514N	1614-018SRP 6.35"
MKII2515N(*) SPECIFY TRIM	1615-001SRP 4.70"-6.35"
MKII2530N	1630-022RP 1630-022SRP 4.90"
MKII2531N	1630-023RP 1630-023SRP 4.40"
MKII2532N	1632-022RP 1632-022SRP 5.65"
MKII2534N	1634-022RP 1634-022SRP 6.15"
MKII2535N(*) SPECIFY TRIM	1635-001SRP 4.10"-6.15"
IMPELLERS - STAINLESS STEEL	
MKII2530S	1630-022RP 1630-022SRP 4.90"
MKII2531S	1630-023RP 1630-023SRP 4.40"

FLYNT	TACO
IMPELLERS - STAINLESS STEEL CONT.	
MKII2532S	1632-022RP 5.65" 1632-022SRP
MKII2535S(*) SPECIFY TRIM	1635-001SRP 4.10"-5.65"
MKII2536S	1636-001SRP 6.40"
MKII2538S	1638-001SRP 6.90"
MKII2540S	1640-001SRP 7.90"
MKII2541S(*) SPECIFY TRIM	1641-001SRP 5.90"-7.90"

FLYNT	TACO
BEARING ASSEMBLY	
MKIIBA-A	121, 122, 1600, 1610, 1611 w/48 121-154RP, 122-002RP
MKIIBA-B	131, 132, 1602, 1604, 1612, 1615, 1630, 1635 w/48 131-144RP, 132-145RP
MKIIBA-C	133,138,1614,1615,1622,1624 ,1632,1634,1635 w/56 133-147RP, 138-153RP
MKIIBA-D	1616, 1618, 1619, 1636, 1638, 1640, 1641

(!) NOT REQUIRED ON MKII/MKIII PUMPS OR WHEN ORDERING MKIIBA-M
 (*) IF IMPELLER DIAMETER IS NOT SPECIFIED, FULL TRIM IMPELLER WILL BE PROVIDED

MKII to "1600" REPAIR PARTS CROSSOVER SHEET

MOTOR ASSEMBLY, 1800 RPM, 1PH, ODP		
FLYNT	TACO	MOTOR SPEC
MKI501750R	132-096RP	115/230/60/1 .50 HP
MKII75MTR	133-119RP	115/230/60/1 .75 HP
MKII10MTR	138-119RP	115/230/60/1 1 HP
MKII15MTR	1636-013RP	115/230/60/1 1.5 HP
MKII29MTR	1638-012RP	115/230/60/1 2 HP

MOTOR ASSEMBLY, 1800 RPM, 1 PH, TEFC		
FLYNT	TACO	MOTOR SPEC
MKI50MTRE	N/A	115/230/60/1 .50 HP
MKII75MTRE	N/A	115/230/60/1 .75 HP
MKII10MTRE	N/A	115/230/60/1 1 HP
MKII15MTRE	N/A	115/230/60/1 1.5 HP

MOTOR ASSEMBLY, 1800 RPM, 3 PH, TEFC		
FLYNT	TACO	MOTOR SPEC
MKII50MTRE-3	N/A	208-230/460/60/3 .50 HP
MKII75MTRE-3	N/A	208-230/460/60/3 .75 HP
MKII10MTRE-3	N/A	208-230/460/60/3 1 HP
MKII15MTRE-3	N/A	208-230/460/60/3 1.5 HP
MKII20MTRE-3	N/A	208-230/460/60/3 2 HP
MKI30MTRE-3	N/A	208-230/460/60/3 3 HP

FLYNT	TACO
MKIITEBRKT	N/A

COUPLERS & INSERTS	
3JE-1258	1624-043RP
4JE-5858	1624-053RP
3JE-SLV	1624-020RP
4JE-SLV	1624-004RP



4410 W UNION HILLS DRIVE
SUITE 7-234
GLENDALE, AZ 85308
info@flyntpumpco.com